

Model: ELEGANT BONE 23"X59" approx.


Codes: 100303476

Water absorption: BIII - Revestimiento (10%≤E≤20%)

Finish: Glazed / Standard

Tone variations: V3

Rectified: Yes

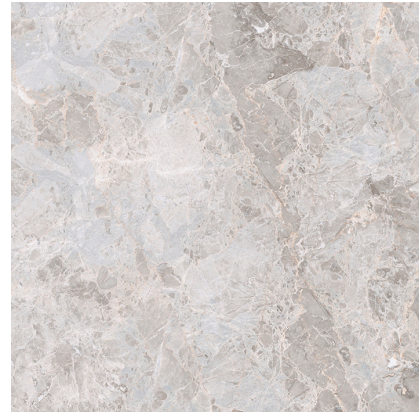



DIMENSIONAL FEATURES

Thickness	7/16" approx	+/-5%*
Width	23 7/16" approx	
Length	59 1/16" approx	
Length and width deviation	Below 0.15%	+/-0.3%*
Side straightness deviation	Below 0.15%	+/-0.3%*
Squareness deviation	Below 0.15%	+/-0.3%*
Surface flatness deviation	Below 0.15%	+/-0.4%*

*ASTM C485/C499/C502

FEATURES

-  Glossy surface finish with a high degree of light reflection.
-  Dynamic coefficient of friction rate
-  General deshaded design with a degree of color and appearance variation.
-  Name given to the finish of those tiles dimensionally improved after the firing process.
-  Wall installation

MECHANICAL FEATURES

Breaking strength	>134.94 LBF	>135LBF*
Modulus of rupture	>3.37 LBF	>=3LBF*
Crazing resistance	Resists 3 cycles	

*ASTM C648

HYGIENIC FEATURES

Chemical resistance	Class "A" for swimming pools and cleaning products (resists attack). Minimum Class "B" for acids and bases	B Min.*
Stain resistance	Class 5. Easy cleaning with water	3 Min.*

*ASTM C650/C1378

ANTI-SLIP VALUE

Dynamic coefficient of friction (dcof)	>0,42	
--	-------	--

*ANSI A326.3

PACKING

Sales units per box	28.87 SQF/CS	
Sales units per pallet	577.36 SQF/PAL	
Sales units per unit	9.62 SQF/ST	

System Certification



Do not use cleaning agents containing hydrofluoric acid.

It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint.

For big sizes, it is recommended to fix with mortars containing polymeric additives and to use the double gluing technique.

Mosaic tiles must be grouted.

This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.

SCOPE OF USE

Technical code-1

1 - Use on walls

System Certification



Do not use cleaning agents containing hydrofluoric acid.
It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint.
For big sizes, it is recommended to fix with mortars containing polymeric additives and to use the double glueing technique.
Mosaic tiles must be grouted.

This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.